



# ENERGY STAR® Program Requirements Product Specification for Imaging Equipment

## Test Method for Determining Imaging Equipment Energy Use Final Draft, Rev. Nov-2018

### 1 OVERVIEW

The following test method shall be used for determining Non-Professional Imaging Product compliance with requirements in the ENERGY STAR Eligibility Criteria for Imaging Equipment.

### 2 APPLICABILITY

ENERGY STAR test requirements are dependent upon the feature set of the products under evaluation. Table 1 shall be used to determine the applicability of each section of this document.

**Table 1: Test Procedure Applicability**

Product Type	Media Format	Marking Technology	ENERGY STAR Evaluation Method
Digital Duplicator	Standard	Stencil	TEC
Mailing Machine	All	DT, EP, IJ, TT	OM
Multifunction Device (MFD)	Standard	High Performance IJ, DT, DS, EP, SI, TT	TEC
		IJ, Impact	OM
	Large	High Performance IJ, DT, DS, EP, IJ, SI, TT	OM
Printer	Standard	High Performance IJ, DT, DS, EP, SI, TT	TEC
		IJ, Impact	OM
	Large or Small	DT, DS, EP, Impact, IJ, SI, TT	OM
	Large	High Performance IJ	OM
	Small	High Performance IJ	TEC
Scanner	All	N/A	OM

### 3 DEFINITIONS

Unless otherwise specified, all terms used in this document are consistent with the definitions in the ENERGY STAR Eligibility Criteria for Imaging Equipment.

## 11 4 TEST SETUP

### 12 4.1 General Test Setup

13 A) Test Setup and Instrumentation: Test setup and instrumentation for all portions of this procedure shall  
14 be in accordance with:

15 1) The requirements of International Electrotechnical Commission (IEC) Standard 62301, Ed. 2.0,  
16 "Measurement of Household Appliance Standby Power", Section 4, "General Conditions for  
17 Measurements" for all products.

18 2) In the event of conflicting requirements, the ENERGY STAR test method shall take precedence.

19 B) Ac Input Power: Products intended to be powered from an ac mains power source shall be connected  
20 to a voltage source appropriate for the intended market, as specified in Table 2 or Table 3.

21 1) Products shipped with external power supplies (EPSs) shall first be connected to the EPS and  
22 then to the voltage source specified in Table 2 or Table 3.

23 2) If a product is rated to operate at a voltage/frequency combination in a specific market that is  
24 different from the voltage/frequency combination for that market (e.g., 230 volts (V), 60 hertz (Hz)  
25 in North America), the unit shall be tested at the manufacturer rated voltage/frequency  
26 combination for that unit. The voltage/frequency used shall be reported.

27 **Table 2: Input Power Requirements for Products with**  
28 **Nameplate Rated Power Less Than or Equal to 1500 W**

Market	Voltage	Voltage Tolerance	Maximum Total Harmonic Distortion	Frequency	Frequency Tolerance
North America, Taiwan	115 V ac	+/- 1.0 %	2.0 %	60 Hz	+/- 1.0 %
Switzerland	230 V ac	+/- 1.0 %	2.0 %	50 Hz	+/- 1.0 %
Japan	100 V ac	+/- 1.0 %	2.0 %	50 Hz or 60 Hz	+/- 1.0 %

29 **Table 3: Input Power Requirements for Products with**  
30 **Nameplate Rated Power Greater than 1500 W**

Market	Voltage	Voltage Tolerance	Maximum Total Harmonic Distortion	Frequency	Frequency Tolerance
North America, Taiwan	115 V ac	+/- 4.0 %	5.0 %	60 Hz	+/- 1.0 %
Switzerland	230 V ac	+/- 4.0 %	5.0 %	50 Hz	+/- 1.0 %
Japan	100 V ac	+/- 4.0 %	5.0 %	50 Hz or 60 Hz	+/- 1.0 %


31 **Note:** EPA has removed Europe, Australia, and New Zealand as a market as none of these markets  
32 have a formal agreement with ENERGY STAR any longer.  
33

34 C) Low-voltage Dc Input Power:

35 1) Products may be powered with a low-voltage dc source (e.g., via network or data connection)  
36 only if the dc source is the only acceptable source of power for the product (i.e., no ac plug or  
37 EPS is available).

- 38 2) Dc-powered products shall be installed and powered as directed by the manufacturer, using a  
 39 port with the full specifications recommended for the UUT (e.g., Universal Serial Bus (USB) 3.1 if  
 40 applicable, even if backwards-compatible with USB 2.0).
- 41 3) The power measurement shall be made between the dc source (e.g., Host Machine) and the  
 42 cable shipped with the product, including the losses introduced by the shipped cable. If no cable  
 43 is shipped with the product, any cable between 2 and 6 feet long may be used in its place. The  
 44 resistance of the cable used to connect the UUT to the point of measurement shall be measured  
 45 and reported.
- 46 Note: The measured resistance of dc power cables includes the sum of resistances of both the dc  
 47 supply voltage wire and the ground wire.
- 48 4) A spliced cable may be used between the shipped cable and dc source in order to connect the  
 49 power meter. If this method is used, the following requirements must be met:
- 50 1) The spliced cable shall be used in addition to the shipped cable described in Section  
 51 4.1.C)3).
- 52 2) The spliced cable shall be connected between the dc source and the shipped cable.
- 53 3) The spliced cable shall be no longer than 1 foot.
- 54 4) For measuring voltage, the total amount of wiring used between the voltage measurement  
 55 and the shipped cable shall be less than 50 milliohms of resistance. This only applies to the  
 56 wiring that is carrying load current.
- 57 Note: Voltage and current need not necessarily be measured at the same location, so long as  
 58 the voltage is measured within 50 milliohms of the shipped cable.
- 59 5) The current measurement can be made either on the ground wire or the dc supply voltage  
 60 wire.
- 61 Note: Figure 1 depicts an example spliced cable setup using a USB 2.0-powered UUT  
 62 connected to the Host Machine.

63 **Figure 1: Example Spliced USB 2.0 Cable Arrangement**

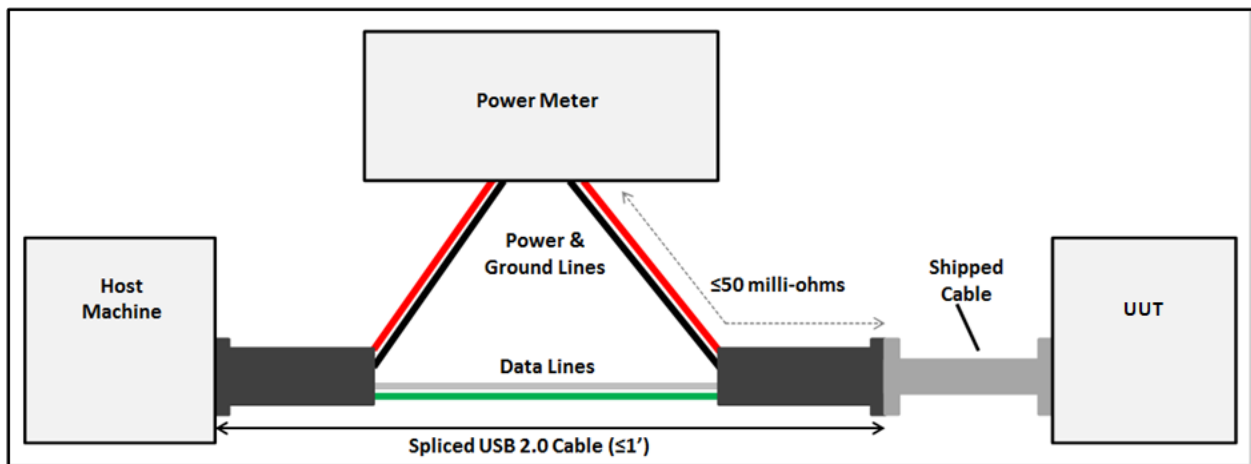

- 64
- 65 D) Ambient Temperature: Ambient temperature shall be 23° C ± 5° C.
- 66 E) Relative Humidity: Relative humidity shall be between 10% and 80%.
- 67 F) Power Meter: Power meters shall possess the following attributes:
- 68 1) Minimum Frequency Response: 3.0 kHz
- 69 2) Minimum Resolution:

- 70 a) 0.01 W for measurement values less than 10 W;  
 71 b) 0.1 W for measurement values from 10 W to 100 W;  
 72 c) 1 W for measurement values from 100 W to 1.5 kW; and  
 73 d) 10 W for measurement values greater than 1.5 kW.  
 74 e) Measurements of accumulated energy should have resolutions which are generally  
 75 consistent with these values when converted to average power. For accumulated energy  
 76 measurements, the figure of merit for determining required accuracy is the maximum power  
 77 value during the measurement period, not the average, since it is the maximum that  
 78 determines the metering equipment and setup.

79 G) Measurement Uncertainty<sup>1</sup>:

- 80 1) Measurements of greater than or equal to 1 W shall have an uncertainty of 2% or better at the  
 81 95% confidence level.  
 82 2) Measurements of less than 1 W shall have an uncertainty of 0.02 W or better at the 95%  
 83 confidence level.

84 H) Time Measurement: Time measurements may be performed with a standard stopwatch or other time  
 85 keeping device with a resolution of at least 1 second.

86 I) Paper Specifications:

- 87 1) Standard Format Products shall be tested in accordance with Table 4.  
 88 2) Large, Small, and Continuous Form products shall be tested using any compatible paper size.

89 **Table 4: Paper Size and Weight Requirements**

Market	Paper Size	Basis Weight (g/m <sup>2</sup> )
North America	8.5" x 11"	75
Taiwan	A4	70
	8.5" x 11"	75
Switzerland	A4	80
Japan	A4	64

90

91 **Note:** EPA has removed Europe, Australia, and New Zealand as a market as none of these markets  
 92 have a formal agreement with ENERGY STAR any longer.

93 **5 PRE-TEST UUT CONFIGURATION FOR ALL PRODUCTS**

94 **5.1 General Configuration**

95 A) As-shipped Condition:

96 1) All products shall be tested in their "as-shipped" configuration unless otherwise specified by this  
 97 test method.

98 B) Product Speed for Calculations and Reporting: The product speed for all calculations and reporting  
 99 shall be the highest speed as claimed by the manufacturer per the following criteria, expressed in  
 100 images per minute (ipm) and rounded to the nearest integer:

---

<sup>1</sup> Measurement uncertainty calculations should be performed according IEC 62301 Ed. 2.0 Appendix D. Only the uncertainty due to the measurement instrument shall be calculated.

- 101 1) In general, for Standard-size products, a single A4 or 8.5" x 11" sheet printed/copied/scanned on  
 102 one side in one minute is equal to 1 (ipm).
- 103 a) When operating in duplex mode a single A4 or 8.5" x 11" sheet printed/copied/scanned on  
 104 both sides in one minute is equal to 2 (ipm).
- 105 2) For all products, the product speed shall be based on:
- 106 a) The highest manufacturer-claimed monochrome print speed, unless the product cannot print,  
 107 in which case,
- 108 b) The highest manufacturer-claimed monochrome copy speed, unless the product cannot print  
 109 or copy, in which case,
- 110 c) The manufacturer-claimed scan speed.
- 111 Note: EPA recommends that manufacturers report print speeds using the ISO/IEC  
 112 24734:2014 test image for consistency with other reporting.
- 113 d) When a manufacturer intends to qualify a product in a certain market by making use of test  
 114 results that qualified the product in another market using other sizes of paper (e.g., A4 versus  
 115 8.5" x 11"), and if its maximum claimed speeds differ when producing images on different  
 116 sizes of paper, the highest speed shall be used.

117 **Table 5: Calculation of Product Speed for Standard, Small, and Large Format Products with the**  
 118 **Exception of Mailing Machines**

Media Format	Media Size	Product Speed, <i>s</i> (ipm)
		<i>Where:</i> <ul style="list-style-type: none"> <li><i>s<sub>P</sub></i> is the maximum claimed monochrome speed in images per minute when processing the given media,</li> <li><i>w</i> is the width of the media, in meters (m),</li> <li><i>ℓ</i> is the length of the media, in meters (m).</li> </ul>
Standard	8.5" x 11"	<i>s<sub>P</sub></i>
	A4	<i>s<sub>P</sub></i>
Small	4" x 6"	0.25 x <i>s<sub>P</sub></i>
	A6	0.25 x <i>s<sub>P</sub></i>
	Smaller than A6 or 4" x 6"	16 x <i>w</i> x <i>ℓ</i> x <i>s<sub>P</sub></i>
Large	A2	4 x <i>s<sub>P</sub></i>
	A0	16 x <i>s<sub>P</sub></i>

- 119 3) For Continuous Form products, product speed shall be calculated per Equation 1.

120 **Equation 1: Calculation of Product Speed**

121 
$$s = 16 \times w \times s_L$$

122 *Where:*

- 123 • *s* is the product speed, in ipm,  
 124 • *w* is the width of the media, in meters (m),  
 125 • *s<sub>L</sub>* is the maximum claimed monochrome speed, in meters per  
 126 minute.

- 127 4) For Mailing Machines, product speed shall be reported in units of mail pieces per minute (mppm).

128 5) The product speed used for all calculations and qualification, as calculated above, may not be the  
129 same as the product speed used for testing.

130 C) Color: For Non-professional Imaging Products, color-capable products shall be tested making  
131 monochrome (black) images.

132 1) For those products without black ink, a composite black shall be used.

133 D) Network Connections: Products that are capable of being network-connected as-shipped shall be  
134 connected to a network.

135 1) Products shall be connected to only one network or data connection for the duration of the test.

136 a) Only one computer may be connected to the UUT, either directly or via a network.

137 b) The UUT shall be connected using a port with the full specifications recommended for the  
138 UUT

139 Example: A Universal Serial Bus (USB) 3.1 port shall be used if present, even if backwards-  
140 compatible with USB 2.0.

141 **Note:** A stakeholder requested clarification as to why Low-voltage Dc Input Power products shall be  
142 installed and powered using a port with the full specifications recommended for the UUT and asked if the  
143 requirement is focused on USB or other ports, as well. This requirement applies to whichever network  
144 connection port is used for connecting the UUT to a computer. EPA and DOE have clarified that the  
145 mention of USB is only an example.

146 2) The type of network connection depends on the characteristics of the UUT and shall be the  
147 topmost connection listed in Table 6 available on the unit as-shipped.

**Table 6: Network or Data Connections for Use in Test**

Order of Preference for Use in Test (if Provided by UUT)	Connections for all Products
1	Ethernet – 1 Gb/s
2	Ethernet – 100/10 Mb/s
3	Wi-Fi
4	USB 3.x
5	USB 2.x
6	USB 1.x
7	RS232
8	IEEE 1284 <sup>2</sup>
9	Other Wired – in order of preference from highest to lowest speed
10	Other Wireless – in order of preference from highest to lowest speed
11	If none of the above, test with whatever connection is provided by the device (or none)

149 3) All data and network cables and routers shall support the highest and lowest data speeds of the  
150 UUT's network interface.

151 Example: In the case of Ethernet, the connection shall be via a standard Category (Cat) 5e or  
152 better cable.

153 4) Products connected to a wireless protocol, such as Wi-Fi, shall be connected in close proximity to  
154 the appropriate router or computer.

155 5) Products connected to Ethernet, per paragraph 5.1.D)2) above, and capable of supporting  
156 Energy Efficient Ethernet (IEEE Standard 802.3az)<sup>3</sup>, shall be connected to a network switch or  
157 router that also supports Energy Efficient Ethernet for the duration of the test.

158 6) The tester shall configure the address layer of the protocol, taking note of the following:

159 1) Internet Protocol (IP) v4 and IPv6 have neighbor discovery and will generally configure a  
160 limited, non-routable connection automatically.

161 2) IP can be configured manually or by using Dynamic Host Configuration Protocol (DHCP) with  
162 an address in the 192.168.1.x Network Address Translation (NAT) address space if the UUT  
163 does not behave normally when autoIP is used. The network shall be configured to support  
164 the NAT address space and/or autoIP.

165 3) The UUT shall maintain this live connection to the network for the duration of testing unless  
166 otherwise specified in this Test Method, disregarding any brief lapses (e.g., when  
167 transitioning between link speeds).

<sup>2</sup> Also referred to as a Parallel or Centronics interface.

<sup>3</sup> Institute of Electrical and Electronics Engineers (IEEE) Standard 802.3az-2010. "IEEE Standard for Information Technology—Telecommunications and Information Exchange Between Systems—Local and Metropolitan Area Networks—Specific Requirements—Part 3: Carrier Sense Multiple Access with Collision Detection (CSMA/CD) Access Method and Physical Layer Specifications." 2010.

- 168 E) Service/Maintenance Modes: Non-Professional Imaging Products shall never be in  
169 service/maintenance modes, including color calibration, during testing.
- 170 1) Service/Maintenance modes shall be disabled prior to testing.
- 171 2) Manufacturers shall provide instructions detailing how to disable service/maintenance modes if  
172 this information is not included in the product documentation packaged with the UUT or is not  
173 readily available online.
- 174 3) If service/maintenance modes cannot be disabled and a service/maintenance mode occurs  
175 during a job other than the first job, the results from the job with the service/maintenance mode  
176 shall be replaced with results from a substitute job. In this case, the substitute job shall be  
177 inserted into the test procedure immediately following Job 4 and the inclusion of the substitute job  
178 shall be reported. Each job period shall be 15 minutes.

## 179 **5.2 Configuration for MFDs with Fax Capability**

- 180 A) All MFDs with fax capability that connect to a telephone line shall be connected to a telephone line  
181 during the test, in addition to the network connection specified by Table 6 if the UUT is network  
182 capable.
- 183 1) In the case that a working phone line is not available, a line simulator may be used as a  
184 replacement.

## 185 **5.3 Configuration for Digital Duplicators**

- 186 A) Except as noted below, digital duplicators shall be configured and tested as printers or MFDs,  
187 depending on their capabilities as-shipped.
- 188 1) Digital duplicators shall be tested at maximum claimed speed, which is also the speed that should  
189 be used to determine the job size for performing the test, not at the default as-shipped speed, if  
190 different.
- 191 2) For digital duplicators, there shall be only one original image.

# 192 **6 PRE-TEST UUT INITIALIZATION FOR ALL PRODUCTS**

## 193 **6.1 General Initialization**

- 194 A) Prior to the start of testing, the UUT shall be initialized as follows:
- 195 1) Set up the UUT per the instructions in the Manufacturer's Instructions or documentation.
- 196 a) Accessories, such as paper source, that are shipped with the base product and are intended  
197 to be installed or attached by the end-user shall be installed as intended for the product  
198 model. Paper shall be placed in all paper sources designated to hold the paper specified for  
199 testing, and the UUT shall pull from the default paper source, using the as-shipped paper  
200 source settings.
- 201 b) If the product is connected to a computer, either directly or via a network, during the test, the  
202 computer shall be running the newest version of the manufacturer's default driver available at  
203 the time of testing using settings corresponding to the default settings upon shipment, unless  
204 otherwise specified in this test method. The print driver version used for testing shall be  
205 recorded.
- 206 i) In the event that a setting does not have a default and is not defined in this test method,  
207 the setting shall be set according to the tester's discretion and shall be recorded.
- 208 ii) When connecting via a network and multiple computers are connected to the network,  
209 print driver settings apply only to the computer sending the print jobs to the UUT.



- 210 c) For products designed to operate on battery power when not connected to the mains power  
 211 source, the battery shall be removed for all tests. For UUTs where operation without a battery  
 212 pack is not a supported configuration, the test shall be performed with fully charged battery  
 213 pack(s) installed, making sure to report this configuration in the test results. To ensure the  
 214 battery is fully charged, perform the following steps:
- 215 i) For UUTs that have an indicator to show that the battery is fully charged, continue  
 216 charging for an additional 5 hours after the indication is present.
- 217 ii) If there is no charge indicator, but the manufacturer's instructions provide a time estimate  
 218 for when charging this battery or this capacity of battery should be complete, continue  
 219 charging for an additional 5 hours after the manufacturer's indication.
- 220 iii) If there is no indicator and no time estimate in the instructions, the duration shall be 24  
 221 hours.
- 222 2) Connect the UUT to its power source.
- 223 3) Power on the UUT and perform initial system configuration, as applicable. Verify that default  
 224 delay times are configured according to product specifications and/or manufacturer  
 225 recommendations.
- 226 a) Product Speed for Testing All Products: All products, except digital duplicators, shall be  
 227 tested with speed settings in their default as-shipped configuration. Digital duplicators shall  
 228 be tested at maximum claimed speed as required in Section 5.3.

229 **Note:** EPA and DOE have clarified that digital duplicators shall be tested at their maximum claimed  
 230 speed.

- 231 b) Auto-off for TEC Products: If a printer, digital duplicator, or MFD with print-capability has  
 232 Auto-off capability and it is enabled as-shipped, it shall be disabled prior to testing.
- 233 c) Auto-off for OM Products: If a product has an Auto-off Mode enabled as-shipped, it shall  
 234 remain enabled for the duration of testing.
- 235 4) User-controllable anti-humidity features shall be turned off or disabled for the duration of testing.
- 236 5) Pre-conditioning: Place the UUT in Off Mode, then let the UUT sit idle for 15 minutes.
- 237 a) For EP-TEC products, let the UUT sit in Off Mode for an additional 105 minutes, for a total of  
 238 at least 120 minutes (2 hours).
- 239 b) Pre-conditioning is only required prior to beginning the first test on each UUT.

## 240 7 TYPICAL ENERGY CONSUMPTION (TEC) TEST PROCEDURE

### 241 7.1 Job Structure

- 242 A) Jobs per Day: The number of jobs per day ( $N_{\text{JOBS}}$ ) is specified in Table 7.

243

**Table 7: Number of Jobs per Day (N<sub>JOBS</sub>)**

Monochrome Product Speed, s (ipm)	Jobs per Day (N <sub>JOBS</sub> )
s ≤ 8	8
8 < s < 32	s
s ≥ 32	32

244

245

246

247

- B) Images per Job: The number of images shall be computed according to Equation 2, below. For convenience, Table 11 at the end of this document provides the resultant images per job computation for each integer product speed up through 100 ipm.

248

**Equation 2: Calculation of Number of Images per Job**

249

$$N_{IMAGES} = \begin{cases} 1 & s < 4 \\ \mathit{int} \left[ \frac{(0.5 \times s^2)}{N_{JOBS}} \right] & s \geq 4 \end{cases}$$

250

251

Where:

252

253

254

255

256

- *N<sub>IMAGES</sub>* is the number of images per job, rounded down (truncated) to the nearest integer,
- *s* is the product speed in images per minute (ipm), calculated in section 5.1.B), of this test procedure, and
- *N<sub>JOBS</sub>* is the number of jobs per day, as calculated per Table 7.

257

258

- C) Test Image: Test Pattern A from ISO/IEC Standard 10561:1999 shall be used as the original image for all testing.

259

260

- 1) Test images shall be rendered in 10 point size in a fixed-width Courier font (or nearest equivalent).

261

262

- 2) German-specific characters need not be reproduced if the product is incapable of German character reproduction.

263

264

- D) Print Jobs: Print jobs for the test shall be sent over the network connection designated in Table 6 immediately before printing each job.

265

266

267

- 1) Each image in a print job shall be sent separately, (i.e., all images may be part of the same document), but shall not be specified in the document as multiple copies of a single original image (unless the product is a digital duplicator).

268

269

- 2) For printers and MFDs that can interpret a page description language (PDL) (e.g., Printer Command Language PCL, Postscript), images shall be sent to the product in a PDL.

270

- E) Copy Jobs:

271

272

- 1) For products with copying capability and with speed less than or equal to 20 ipm, there shall be one original per required image.

273

274

275

276

- 2) For products with copying capability and with speed greater than 20 ipm, it may not be possible to match the number of required original images (i.e., due to limits on document feeder capacity). In this case, it is permissible to make multiple copies of each original, and the number of originals shall be greater than or equal to ten.

277  
278

**Example:** For a 50 ipm unit that requires 39 images per job, the test may be performed with four copies of 10 originals or three copies of 13 originals.

279  
280  
281

- 3) Originals may be placed in the document feeder before the test begins.
  - a) Products without a document feeder may make all images from a single original placed on the platen.

## 282 7.2 Measurement Procedures

283  
284  
285

- A) Measurement of TEC shall be conducted according to Table 8 for printers, digital duplicators, and MFDs with print capability, and Table 9 for digital duplicators and MFDs without print capability, subject to the following provisions:

286  
287  
288  
289  
290

- 1) Paper: There shall be sufficient paper in the UUT to perform the specified print or copy jobs.
- 2) Duplexing: Products shall be tested in simplex mode, unless the speed of duplex mode output is greater than the speed of simplex mode output, in which case they shall be tested in duplex mode. In all cases, the mode in which the unit was tested and the print speed used must be documented. Originals for copying shall be simplex images.

291  
292

- 3) Energy Measurement Method: All measurements shall be recorded as accumulated energy over time, in Wh; all time shall be recorded in minutes.

293  
294

- a) "Zero meter" references may be accomplished by recording the accumulated energy consumption at that time rather than physically zeroing the meter.

**Table 8: TEC Test Procedure for Printers, Digital Duplicators with Print Capability, and MFDs with Print Capability**

Step	Initial State	Action	Record (at end of step)	Unit of Measure	Possible States Measured
1	Off	Connect the UUT to the meter. Ensure the unit is powered and in Off Mode. Zero the meter; measure energy over 5 minutes or more. Record both energy and time.	Off energy	Watt-hours (Wh)	Off
			Testing Interval time	Minutes (min)	
2	Off	Turn on unit. Wait until unit indicates it is in Ready Mode.	–	–	–
3	Ready	Print a job of at least one output image but no more than a single job per Table 11. Measure and record time to first sheet exiting unit.	Active0 time	Seconds (s)	–
4	Ready (or other)	Wait until the meter shows that the unit has entered its final Sleep Mode or the time specified by the manufacturer.	Default delay time to Sleep, $t_{DEFAULT}$	Minutes (min)	–
5	Sleep	Zero meter; measure energy and time over 1 hour. Record the energy and time.	Sleep energy, $E_{SLEEP}$	Watt-hours (Wh)	Sleep
			Sleep time, $t_{SLEEP} (\leq 1 \text{ hr})$	Minutes (min)	
6	Sleep	Zero meter and timer. Print one job (calculated above). Measure energy and time. Record time to first sheet exiting unit. Measure energy over 15 minutes from job initiation. The job must finish within the 15 minutes.	Job1 energy, $E_{JOB1}$	Watt-hours (Wh)	Recovery, Active, Ready, Sleep
			Active1 time	Seconds (s)	
7	Ready (or other)	Repeat Step 6.	Job2 energy, $E_{JOB2}$	Watt-hours (Wh)	Same as above
			Active2 time	Seconds (s)	
8	Ready (or other)	Repeat Step 6 (without Active time measurement).	Job3 energy, $E_{JOB3}$	Watt-hours (Wh)	Same as above
9	Ready (or other)	Repeat Step 6 (without Active time measurement).	Job4 energy, $E_{JOB4}$	Watt-hours (Wh)	Same as above
10	Ready (or other)	Zero meter and timer. Measure energy and time until meter and/or unit shows that unit has entered Sleep Mode or the final Sleep Mode for units with multiple Sleep modes, or the time specified by the manufacturer, if provided. Record energy and time.	Final energy, $E_{FINAL}$	Watt-hours (Wh)	Ready, Sleep
			Final time, $t_{FINAL}$	Minutes (min)	

297 *Note: Steps 4 and 10: For those units that do not indicate when they have entered the Final Sleep Mode,*  
 298 *manufacturers shall specify the time to Final Sleep Mode for testing purposes.*  
 299

**Table 9: TEC Test Procedure for Digital Duplicators without Print Capability and MFDs without Print Capability**

Step	Initial State	Action	Record	Unit of Measure	Possible States Measured
1	Off	Connect the UUT to the meter. Ensure the unit is powered and in Off Mode. Zero the meter; measure energy over 5 minutes or more. Record both energy and time.	Off energy	Watt-hours (Wh)	Off
			Testing Interval time	Minutes (min)	
2	Off	Turn on unit. Wait until unit has entered Ready Mode.	–	–	–
3	Ready	Copy a job of at least one image but no more than a single job per Table 11. Measure and record time to first sheet exiting unit	Active0 time	Seconds (s)	–
4	Ready (or other)	Wait until the meter shows that the unit has entered its final Sleep Mode or the time specified by the manufacturer and measure the default time to sleep	Default delay time to Sleep, $t_{DEFAULT}$	Minutes (min)	–
5	Sleep	Zero meter; measure energy and time over 1 hour or until unit enters Auto-off Mode. Record the energy and time.	Sleep energy, $E_{SLEEP}$	Watt-hours (Wh)	Sleep
			Sleep time, $t_{SLEEP} (\leq 1 \text{ hr})$	Minutes (min)	
6	Sleep	Zero meter and timer. Copy one job (calculated above). Measure and record energy and time to first sheet exiting unit. Measure energy over 15 minutes from job initiation. The job must finish within the 15 minutes.	Job1 energy, $E_{JOB1}$	Watt-hours (Wh)	Recovery, Active, Ready, Sleep, Auto-off
			Active1 time	Seconds (s)	
7	Ready (or other)	Repeat Step 6.	Job2 energy, $E_{JOB2}$	Watt-hours (Wh)	Same as above
			Active2 time	Seconds (s)	
8	Ready (or other)	Repeat Step 6 (without Active time measurement).	Job3 energy, $E_{JOB3}$	Watt-hours (Wh)	Same as above
9	Ready (or other)	Repeat Step 6 (without Active time measurement).	Job4 energy, $E_{JOB4}$	Watt-hours (Wh)	Same as above
10	Ready (or other)	Zero meter and timer. Measure energy and time until meter and/or unit shows that unit has entered its Auto-off Mode or the time specified by the manufacturer. Record energy and time; if unit began this step while in Auto-off Mode, report both energy and time values as zero.	Final energy, $E_{FINAL}$	Watt-hours (Wh)	Ready, Sleep
			Final time, $t_{FINAL}$	Minutes (min)	
11	Auto-off	Zero the meter; measure energy and time over 5 minutes or more. Record both energy and time.	Auto-off energy, $E_{AUTO}$	Watt-hours (Wh)	Auto-off
			Auto-off time, $t_{AUTO}$	Minutes (min)	

302 *Note: Steps 4 and 10: For those units that do not indicate when they have entered the Final Sleep Mode,*  
303 *manufacturers shall specify the time to Final Sleep Mode for testing purposes.*

304 **8 OPERATIONAL MODE (OM) TEST PROCEDURE**

305 **8.1 Measurement Procedures**

- 306 A) Measurement of OM power and delay times shall be conducted according to Table 10, subject to the  
307 following provisions:
- 308 1) Power Measurements: All power measurements shall be made using either the average power or  
309 accumulated energy approaches as described below:
- 310 a) Average Power Method: The true average power shall be measured over the course of a  
311 user selected period, which shall be no less than 5 minutes.
- 312 i) For those modes that do not last 5 minutes, the true average power shall be measured  
313 over the mode's entire duration.
- 314 b) Accumulated Energy Approach: If the test instrument is incapable of measuring the true  
315 average power, the accumulated energy consumption over the course of a user selected  
316 period shall be measured. The test period shall be no less than 5 minutes. The average  
317 power shall be determined by dividing the accumulated energy consumption (in watt-hours)  
318 by the time of the test period (in hours).
- 319 i) For those modes that do not last 5 minutes, the accumulated energy consumption shall  
320 be measured over the mode's entire duration.
- 321 c) If the power consumption of the tested mode is periodic, then the test duration shall contain  
322 one or more complete periods.

**Table 10: Operational Mode (OM) Test Procedure**

Step	Initial State	Action(s)	Record	Unit of Measure
1	Off	Plug the UUT into meter. Turn on unit. Wait until unit indicates it is in Ready Mode.	–	
2	Ready	Print, copy, or scan a single image.	–	
3	Ready	Measure Ready power.	Ready power, $P_{READY}$	Watts (W)
4	Ready	Wait and measure Default Delay Time to Sleep.	Sleep default-delay time, $t_{DEFAULT}$	Minutes (min)
5	Sleep	Measure Sleep power.	Sleep power, $P_{SLEEP}$	Watts (W)
6	Sleep	Wait and measure default delay time to Auto-off. (Disregard if no Auto-off Mode).	Auto-off default-delay time	Minutes (min)
7	Auto-off	Measure Auto-off power. (Disregard if no Auto-off Mode).	Auto-off power $P_{AUTO-OFF}$	Watts (W)
8	Auto-off	Manually turn device off and wait until unit is off. (If no manual on-off switch, note and wait for lowest-power Sleep state).	–	–
9	Off	Measure Off power. (If no manual on-off switch, note and measure Sleep Mode power).	Off power $P_{OFF}$	Watts (W)

324 **Notes:**

- 325 • Step 1 – If the unit has no Ready indicator, use the time at which the power consumption level  
326 stabilizes to the Ready level, and note this detail when reporting the product test data.
- 327 • Step 4 – The Default Delay Time shall be measured starting from the completion of the job until  
328 the unit enters Sleep Mode.
- 329 • Steps 4 and 5 – For products with more than one Sleep level, repeat these steps as many times  
330 as necessary to capture all successive Sleep levels and report these data. Two Sleep levels are  
331 typically used in MFDs that use high-heat marking technologies. For products lacking this Mode,  
332 disregard Steps 4 and 5.
- 333 • Steps 4 and 5 – For products without a Sleep Mode, perform and record measurements from  
334 Ready Mode.
- 335 • Steps 4 and 6 – Default-delay time measurements are to be measured in parallel fashion,  
336 cumulative from the start of Step 4. For example, a product set to enter a Sleep level in 15  
337 minutes and enter a second Sleep level 30 minutes after entering the first Sleep level will have a  
338 15-minute default-delay time to the first level and a 45 minute default-delay time to the second  
339 level.

340 **9 TEST PROCEDURES FOR PRODUCTS WITH A DIGITAL FRONT**  
341 **END (DFE)**

342 This step applies only to products that have a DFE as defined in Section 1 of the ENERGY STAR  
343 Program Requirements for Imaging Equipment.

344 **9.1 Ready Mode DFE Test**

- 345 A) Products that are network-capable as-shipped shall be connected during testing. The network  
346 connection used shall be determined using Table 6.
- 347 B) If the DFE has a separate main power cord, regardless of whether the cord and controller are internal  
348 or external to the imaging product, a 10 minute power measurement of the DFE alone shall be made,  
349 and the average power recorded while the main product is in Ready Mode.
- 350 C) If the DFE does not have a separate main power cord, the tester shall measure the dc power required  
351 for the DFE when the unit as a whole is in Ready Mode. This will most commonly be accomplished by  
352 taking an instantaneous power measurements of each dc input into the DFE and adding them  
353 together for the total dc power.

354 **9.2 Sleep Mode DFE Test**

355 This testing shall be performed to obtain the Sleep Mode power of a DFE device over a 1 hour period.  
356 The resulting value will be used to qualify Imaging Equipment products that incorporate DFEs with  
357 network-capable Sleep Modes.

- 358 A) Products that are network-capable as-shipped shall be connected during testing. The network  
359 connection used shall be determined using Table 6.
- 360 B) If the DFE has a separate main power cord, regardless of whether the cord and controller are internal  
361 or external to the imaging product, a 1 hour power measurement of the DFE alone shall be made,  
362 and the average power recorded while the main product is in Sleep Mode. At the end of the 1 hour  
363 power measurement, a print job shall be sent to the main product to ensure the DFE is responsive.
- 364 C) If the DFE does not have a separate main power cord, the tester shall measure the dc power required  
365 for the DFE when the unit as a whole is in Sleep Mode. A 1 hour power measurement of the dc input  
366 to the DFE shall be made, and the average power recorded while the main product is in Sleep Mode.  
367 At the end of the 1 hour power measurement, a print job shall be sent to the main product to ensure  
368 the DFE is responsive.
- 369 D) In cases B) and C), the following requirements apply:
- 370 1) Manufacturers shall provide information on:
- 371 a) Whether DFE Sleep Mode is enabled as-shipped; and
- 372 b) The expected time to sleep of the DFE.
- 373 2) If the DFE does not respond to the print request at the end of 1 hour, the Ready Mode power  
374 level measured in the test method shall be reported as the Sleep Mode power.
- 375

376 *Note: All information specified or provided by manufacturers for product testing shall be publicly available.*

377 **10 REFERENCES**

- 378 A) ISO/IEC 10561:1999. Information technology — Office equipment — Printing devices — Method  
379 for measuring throughput — Class 1 and Class 2 printers.
- 380 B) IEC 62301:2011. Household Electrical Appliances – Measurement of Standby Power. Ed. 2.0.



Table 11: Number of Images per Day Calculated for Product Speeds, s, from 1 to 100 ipm

Speed (ipm)	Jobs/Day (from Table 7, used only to calculate Images/Job)	Unrounded Images/ Job	Images/ Job	Speed (ipm)	Jobs/Day (from Table 7, used only to calculate Images/Job)	Unrounded Images/ Job	Images / Job
1	8	0.06	1	51	32	40.64	40
2	8	0.25	1	52	32	42.25	42
3	8	0.56	1	53	32	43.89	43
4	8	1.00	1	54	32	45.56	45
5	8	1.56	1	55	32	47.27	47
6	8	2.25	2	56	32	49.00	49
7	8	3.06	3	57	32	50.77	50
8	8	4.00	4	58	32	52.56	52
9	9	4.50	4	59	32	54.39	54
10	10	5.00	5	60	32	56.25	56
11	11	5.50	5	61	32	58.14	58
12	12	6.00	6	62	32	60.06	60
13	13	6.50	6	63	32	62.02	62
14	14	7.00	7	64	32	64.00	64
15	15	7.50	7	65	32	66.02	66
16	16	8.00	8	66	32	68.06	68
17	17	8.50	8	67	32	70.14	70
18	18	9.00	9	68	32	72.25	72
19	19	9.50	9	69	32	74.39	74
20	20	10.00	10	70	32	76.56	76
21	21	10.50	10	71	32	78.77	78
22	22	11.00	11	72	32	81.00	81
23	23	11.50	11	73	32	83.27	83
24	24	12.00	12	74	32	85.56	85
25	25	12.50	12	75	32	87.89	87
26	26	13.00	13	76	32	90.25	90
27	27	13.50	13	77	32	92.64	92
28	28	14.00	14	78	32	95.06	95
29	29	14.50	14	79	32	97.52	97
30	30	15.00	15	80	32	100.00	100
31	31	15.50	15	81	32	102.52	102
32	32	16.00	16	82	32	105.06	105
33	32	17.02	17	83	32	107.64	107
34	32	18.06	18	84	32	110.25	110
35	32	19.14	19	85	32	112.89	112
36	32	20.25	20	86	32	115.56	115
37	32	21.39	21	87	32	118.27	118
38	32	22.56	22	88	32	121.00	121
39	32	23.77	23	89	32	123.77	123
40	32	25.00	25	90	32	126.56	126
41	32	26.27	26	91	32	129.39	129
42	32	27.56	27	92	32	132.25	132
43	32	28.89	28	93	32	135.14	135
44	32	30.25	30	94	32	138.06	138
45	32	31.64	31	95	32	141.02	141
46	32	33.06	33	96	32	144.00	144
47	32	34.52	34	97	32	147.02	147
48	32	36.00	36	98	32	150.06	150
49	32	37.52	37	99	32	153.14	153
50	32	39.06	39	100	32	156.25	156

